



**BlackBerry Pearl (8100 & 8120)**

**Carrier: T-Mobile**

---

**Software tested:** 4.2.1.107 & 4.5.0.124

**How to find the software version:** On the Home screen press **Settings → Options → About**

**Note:** **BMW makes no guarantees or warranties as to the performance of each phone while connected to your BMW via Bluetooth® Wireless Technology. Furthermore, software releases by BMW, the phone supplier or the wireless carrier dated after testing might alter compatibility results.**

---

**Vehicles compatible:**

1 Series  
3 Series  
5 Series  
6 Series  
7 Series  
7 Series  
X3  
X5  
X6  
Z4

**Produced after**

March 2005  
March 2005  
March 2005  
March 2005  
March 2005 to September 2008  
November 2008  
March 2005  
April 2005  
April 2008  
March 2009

---

**Pairing Instructions:**

1. Set vehicle in pairing mode. For details please see the vehicle user's manual.
2.
  - To turn Bluetooth on at handset: On the Home screen press Settings → Options → Bluetooth → press Menu Button → Enable Bluetooth
  - To search for Bluetooth devices: On the Home screen press Settings → Options → Bluetooth → press Menu Button → select Add Device. On Add Device screen select Search for devices from here → OK
  - Your phone will display a list of any Bluetooth device(s) that it discovers in range and available to be paired. Select the name of the Bluetooth enabled device (e.g. BMWxxxx) with which you are pairing and press Select. Please note that the Bluetooth enabled device name may first appear as "Handsfree".
3. Type in a passkey on the handset first (on some BMW models, the passkey that is required for this step is fixed. See the car manual for the passkey. On all other cars the passkey can be selected by the user). Press track ball.



4. The Confirm Passkey dialog appears on the display of the car:



Repeat the passkey that was used on the handset to authenticate the handset and press Confirm passkey.

---

### Limitations:

#### 1. Pairing


The user will be unable to carry out the initial pairing process on subsequent occasions in the following scenario:

- Handset is deleted from the vehicle pairing menu.
- Vehicle is not deleted from the paired devices menu located in the Bluetooth menu.

Recommended Action: Please enter Bluetooth Passkey first on mobile phone. Ensure that the handset is deleted from the vehicle's pairing menu, and the vehicle (i.e. BMWxxxxx) tag is deleted from the paired devices menu, located in the Bluetooth menu of the handset.

#### 2. Reconnection

After pairing, when the device asks if the user wants to connect to BMW xxxx, and the user checks the box "yes", make sure that they also check the option "Don't ask this again" so that the Blackberry gets reconnected automatically.

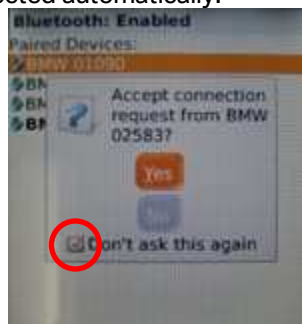

#### 3. No entries from SIM card are visible in car kit

Please copy entries from SIM card to the internal telephone directory.

#### 4. Call Waiting

We recommend to deactivate Call waiting. To deactivate Call Waiting, go to Call Log → Options → Call Waiting → Enable → No

#### 5. Grouping Contacts causes phone error message (only with phone SW earlier than 4.5.x.x)

If the Phonebook contains group of contacts, it will cause an error during the connection to the car kit and the handset will disconnect from vehicle issuing "uncaught exception java.lang class cast exception".

Recommended Action: please don't save your contacts within a group, save them separately.

#### 6. Multi Party Call

Cars equipped with Navigation systems produced after 09/2008 are capable of Multi Party Call features.



**7. Phonebook transfer**

Users with Blackberry firmware older than 5.0 and enterprise account may have to follow steps below to get phonebook downloaded.

Go to Settings > Options> Security Options > General Settings then scroll down and select "Contact Book" and change the option from "Yes" to "No".

The Blackberry handset may request that you to enter the Enterprise password before it makes the change.