



HTC XV6900

Carrier: Verizon Wireless

Software tested: 1.15.605.9

How to find the software version: On the Home screen touch **Start → Settings → System-Tab → About → Version-Tab**

Note: **BMW makes no guarantees or warranties as to the performance of each phone while connected to your BMW via Bluetooth® Wireless Technology. Furthermore, software releases by BMW, the phone supplier or the wireless carrier dated after testing might alter compatibility results.**

Vehicles compatible:

1 Series
3 Series
5 Series
6 Series
7 Series
7 Series
X5
X6
Z4

Produced after


September 2005
September 2005
September 2005
September 2005
March 2007 to September 2008
November 2008
October 2005
April 2008
March 2009

Pairing Instructions:

1. Set vehicle in pairing mode. For details please see the vehicle user's manual.
2.
 - To turn Bluetooth on at handset: On the Home screen press Start → Settings → Connections-Tab → Bluetooth → Mode-Tab → turn on Bluetooth → OK
 - To search for Bluetooth devices: On the Home screen press Start → Settings → Connections-Tab → Bluetooth → Devices-Tab → Add new device
 - Your phone will display a list of any Bluetooth device(s) that it discovers in range and available to be paired. Select the name of the Bluetooth enabled device (e.g. BMWxxxx) with which you are pairing and press Select. Please note that the Bluetooth enabled device name may first appear as "Handsfree".
3. Type in a passkey on the handset first (on some BMW models, the passkey that is required for this step is fixed. See the car manual for the passkey. On all other cars the passkey can be selected by the user).



4. The Confirm Passkey dialog appears on the display of the car:

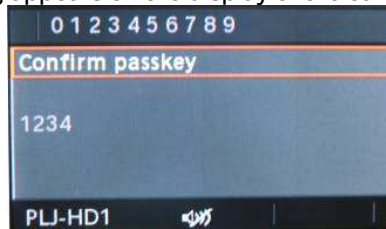

Repeat the passkey that was used on the handset to authenticate the handset and press Confirm passkey.

5. On phone press Next → Done to complete pairing procedure.

Limitations:

1. **@-Symbol Character**
On phonebook entries containing the @-symbol the @-symbol and following characters may not be visible to car.
2. **Automatic Phonebook transfer**
After pairing procedure the user may have to wait at about 30s for Confirm contact list transfer Screen.



Please press Yes to allow automatic phonebook transfer after phone reconnects to car. This screen will appear once after pairing or, if it times out, after each reconnect until you answer.

3. **No automatic audio transfer during active call after reconnecting to car kit**
After phone reconnects automatically to car kit during an active call (Active Call screen displayed at Headunit), user has to transfer audio manually to car kit by pressing Menu Button → Turn Hands-free On
Scenarios:
 - User turns off Bluetooth on Headunit during an active call and on again.
 - User turns off Bluetooth at handset during an active call and on again.
 - User enters car with active call on handset.
 - User takes handset out of Bluetooth range and re-enters the range area with an active call
4. **Call Waiting is not completely supported**
5. **Enhanced contact information**
Cars equipped with Navigation systems produced after 09/2008 are able to display enhanced contact information.