



Apple iPhone 3GS (16GB & 32GB variants)

Carrier: AT&T

Software tested: 3.0, 3.1,4.0,4.0.1

How to find the software version: On the Home screen touch **Settings → General → About**

Note: **BMW makes no guarantees or warranties as to the performance of each phone while connected to your BMW via Bluetooth® Wireless Technology. Furthermore, software releases by BMW, the phone supplier or the wireless carrier dated after testing might alter compatibility results.**

Vehicles compatible:

1 Series
3 Series
5 Series
6 Series
7 Series
7 Series
X5
X6
Z4

Produced after

September 2008
September 2005
September 2005
September 2005
March 2005 to September 2008
November 2008
October 2006
April 2008
March 2009


Pairing Instructions:

1. Set vehicle in pairing mode. For details please see the vehicle user's manual.
2. On the Home screen touch **Settings → General → Bluetooth**
Your phone will display a list of any Bluetooth device(s) that it discovers in range and available to be paired



Select the name of the Bluetooth enabled device (e.g. BMW57013) with which you are pairing. Please note that the Bluetooth enabled device name may first appear as "Handsfree".

3. Type in a 4-16 digit passkey on the iPhone first (on some BMW models like X3, Z4 and 7 series the passkey that is required for this step is fixed. See the car manual for the passkey. On all other cars the 4-16 digit passkey can be selected by the user). Touch "Connect"

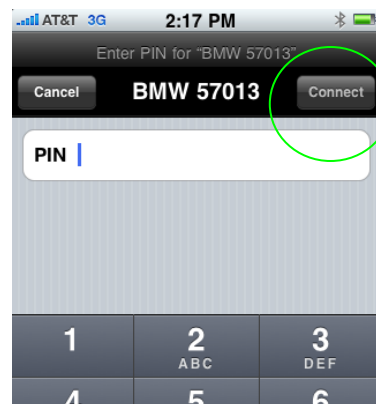

4. Then the Confirm Passkey dialog appears in the display of the car:



Repeat the passkey that was used on the device to authenticate the iPhone and press Confirm passkey.

Limitations:

1. **Accessory message pop-up**
All current BMW software levels have been approved before the availability of iPhones. The message has no effect on function and times out automatically after approx. 15 sec.



2. **Accepting incoming calls at cell phone**

If user accepts an incoming call at the iPhone the call remains in privacy mode, but may be transferred to the car by touching the audio source button.



3. **Call Waiting is not completely supported**

During a Bluetooth® hands free phone call, the hands free audio connection will be lost if a call waiting call is acknowledged via the handset. Please note: Bluetooth protocol does not support call waiting functions.

Scenarios:

- During an active phone call, a second incoming call (call waiting call) is received and 'accept call' is selected. The communication menu shows the call time counter still counting and the radio remains muted for approximately 40 seconds. The second incoming call will be lost.
- If first call is terminated via the vehicle when the handset has a second incoming call. The communication menu shows the call time counter still counting and the radio remains muted for approximately 40 seconds. The second incoming call will be lost.

BMW of North America, LLC does not recommend using the handset to answer a call or switch between two calls while driving. There are two options to avoid this handset issue:

- Call waiting can be disabled via the iPhone. To turn call waiting off, please go into Settings -> phone -> Call waiting and set it to off.

During an active phone call, if a second incoming call (call waiting call) is received to not 'accept' or 'reject' the second incoming.

4. **No entries from SIM card are visible in car kit**

Please copy entries from SIM card to the internal telephone directory.


5. **@-Symbol Character**

On phonebook entries containing the @-symbol the @-symbol and following characters may not be visible in the car.



6. Basic Call Volume

Call volume also can be adjusted at the phone. To avoid high volume differences between cars audio level and call volume level press Volume up button on the iPhone during an active call. This also increases the call volume level at car.

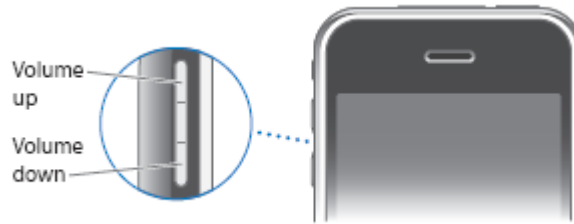

7. Multi Party Call and Enhanced contact information

Cars equipped with Navigation systems produced after 09/2008 are able to display enhanced contact information as well as Multi Party Call features.

8. Calling during phone book update

It is not recommended to use the phone for calling when the phonebook is uploaded to the car.

The phonebook is uploaded each time after a reconnect to the car.

9. Audio playback with Smart Phone Integration

To use the music portion (iPod) of the iPhone when the iPhone is plugged into the cradle other USB devices or USB cable have to be unplugged from the AUX USB interface.